

GLIDING FEDERATION OF AUSTRALIA.

AIRWORTHINESS DIRECTIVE GLIDERS:

REF. No. GFA/AD 203 SCHLEICHER 10

GLIDER TYPE AFFECTED: Schleicher ASW 19 and ASW 20 All Serial numbers.


BACKGROUND:

L.B.A. Airworthiness Directive 81-74/2 Schleicher has been received advising that there is a possibility in some aircraft that the aileron hinge shaft may not be correctly secured.

REQUIRED ACTIONS

Unless already accomplished, check all the aileron hinges before further flight after receipt of this directive to ensure that the pop rivet securing the aileron hinge shaft is in place. (See illustration).

Ground notch

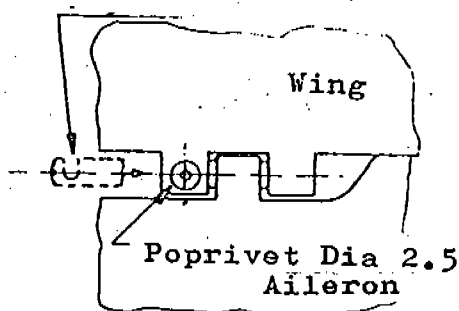

The rivet head should be able to be felt under the adhesive gap sealing tape but if necessary remove the tape to facilitate checking.

The inspection and if necessary the fitting of securing pop rivet is to be carried out by the holder of a Glider Inspectors Certificate DOT 1109 endorsed for standard repairs, replacement of Components or Certificate of Airworthiness Inspections.

Details of the inspection are to be entered in the gliders log book.

COMPLIANCE:

The requirements of this directive are mandatory. This directive is issued pursuant to Air Navigation Regulations under delegated authority from the Secretary of the Department of Transport.

Douglas Lyon

DOUGLAS LYON
CHIEF TECHNICAL OFFICER AIRWORTHINESS
GLIDING FEDERATION OF AUSTRALIA

Date of issue: 29th May, 1981