

THE GLIDING FEDERATION OF AUSTRALIA

BUILDING 130, WIRRAWAY ROAD, ESSENDON AIRPORT, VICTORIA 3041.

GFA/AD 242
SZD 29
Issue 1
Date of issue 5.10.1982
Sheet 1 of 2

AIRWORTHINESS DIRECTIVE GLIDER/POWERED SAILPLANE.

TYPE AFFECTED: - The following 'Jantar' gliders -

SZD - 37X	SZD - 42
SZD 37	SZD - 42 - 1
SZD 38	SZD - 42-2 up to serial No. B-1130 incl.
SZD 38A	SZD - 48
SZD 41	SZD-48-1 up to Serial No. B-1202 incl.
SZD 41A	. SZD- 49
SZD 41B	•

SUBJECT:

Securing instrument panel cover.

BACKGROUND:

Experience shows that if the two screws which locate the instrument panel cover become loose, the cover can be dislodged in flight. Bulletin BK-015/81 "Jantar", was issued by the manufacturer detailing this modification.

REQUIRED ACTION:

At or before next Form 2 inspection:-

- (1) Make two plates to Fig. 1.
- (2) Fit plates as shown in Fig 2 bending up the legs to secure the cover under the head of the locating screw.

IMPLEMENTATION:

This modification may be carried out by the owner/operator, Details to be noted in the log book.

COMPLIANCE:

The requirements of this Airworthiness Directive are mandatory. This Directive is issued pursuant to Air Navigation Regulations under delegated authority from the Secretary of the Department of Aviation.

M.P. BURNS.

Jule Burns

CHIEF TECHNICAL OFFICER AIRWORTHINESS

GLIDING FEDERATION OF AUSTRALIA



THE GLIDING FEDERATION OF AUSTRALIA

BUILDING 130, WIRRAWAY HOAD, ESSENDON AIRPORT, VICTORIA 3041.

BIULETYN Nr BK-015/81"JANTAR"

GFA/AD 242	
SZD 29	
Issue 1	
5.10.1982	

Sheet 2 of 2

Make 2 plates from .5mm aluminium

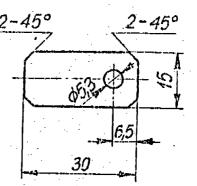


Fig.1.

